			<u> </u>
FHEA NO. 5.3.1 CRIFFEALITY 2/2 FAILURE MODE AND CAUSE No output signal to the VSU. Neither video nor synchronization information is present. Al Sync Generator Clock Divider Chain. 2294880-504	FAILURE EFFECT ON END ITEN Loss of camera output depicting scene informa- tion within FOV of lens assembly. Worst Case: Loss of mission critical	SHUTTLE CCTV CRETICAL ITEMS LIST RATIONALE FOR ACCEPTANC DESIGN FEATURES The TVC/Lens Assembly is comprised of 16 electrical su are RCA Astro designed and fabricated using standard p construction. The remaining three assemblies, high vo and stepper notors, are vendor supplied components whi purchased according to RCA Specification Control Drawi	bassemblies; 13 subassemblies rinted-circuit board type of llage power supply, oscillator, th have been specified and
A2 Camera liming topic 2294881-501 A4 Sync formatter. Video Output Drive. 2294884-503 A5 Power On/Olf Switching. Input Voltage Preregulators. Output Voltage Regulators. 2294885-501 A7 DC-DC Converters Primary Oscillator Driver. Secondary Rectifiers/filters. 2294886-503 A13 Master Oscillator 2295527-1	videa.	neering and reliability assurance. Specifications per establish the design, performance, test, qualification for a procured piece of equipment. Parts, materials, processes, and design guidelines for specified in accordance with RCA 2295503. This docume ments for selection and control of EEE parts. To the with availability, all parts have been selected from m JAN level, as a minimum. In addition to the overall's general purpose preferred parts has been defined by the ment Systems Division Standard Parts List. In the case microcircuits, devices are screened and tested to the procured under the designations of HI-REL/JMQ and SMC Instruments Corp, respectively. Parts not included in used in the design only after a nonstandard item appropared, submitted to Reliability Assurance Engineering the specific application(s) defined in the MSIAF by NA Worst-Case Circuit Analyses have been performed and do designs to demonstrate that sufficient operating margin conditions. The analysis was worst case-in that the weather was set to limits that will drive the output A component application review and analysis was conductored in each piece part by the temperature extremes qualification testing does not exceed the stress derat 2295503. In addition, an objective examination of the design was CDR to verify that the IVC/Lens assembly met specifical ments.	the SCD are prepared to and acceptance requirements the Shuttle CCTV program are not defines the program requiremanimum extent, and consistent litary specifications at the election criteria, a subset of is document and the RCA Governe of the CMOS and TIL family of HIL-SID-803C equivalent and SALS from RCA-SSO and lexas the above documents have been val form (NSIAF) has been pre-(RAE) and approved for use in SA-JSC. Councited for all circuit os exist for all operating slue for each of the variable the amaximum (or minimum). Led to verify that the applied identified with environmental ing values identified in RCA
	चू	i	

REVISED 10-14-86

FHEA NO. 5.3.1 CRITICALITY 2/2		SHUTTLE CCTV CRITICAL ETENS LIST	UNIT TYC/NLA DWG NO. 2794819-506, 508/ 2307808-503 SMEET 2 OF 9
	RAILCHALE FOR ACCEPTA OFSIGN FEATURES (Continued) BARE BOARD DESIGN (A1, A4, A6, A7) The design of the associated A1, A4, A6, A7 boards is copper—clad epoxy glass sheets (NENA G-10) Grade FR—connections are made through printed traces which rubeard surfaces. Every trace terminates at an annula surrounds the hole in which a component lead or term provides a footing for the solder, ensuring good mec performance. Its size and shape are governed by Mill spacing and routing. These requirements are reitera notes to further assure compliance. Variations betwinal product (due to irregularities of the etching drawing notes. This prevents making defective board house no lead or terminal, but serve only to electric board layers, contain stitch bars for mechanical sup. The thru holes are drilled from a drill tape thus all human error and allowing tight control over hele and important reliability criterion. After drilling and tip-lead plated per HRL-SID-1495. This provides for the time of board assembly, even after periods of promponent leads are installed in a manner which assurcomponent leads are pre-tinned, allowing tetal wetting for final assembly. The board is coated with urethousidity and contamination. BOARD PLACEMENT (A1, A2, A4, A6) The A1, A2, A4, and A6 boards are secured in the plen beryllium copper card guides. Connections are made to connectors. Diseagagement during launch is prevented connectors. Diseagagement during launch is prevented.	SHEET 2 OF 9 SHEET 2 OF 9 MCE s constructed from laminated 4), PER MIL-P-55617A. Circuit n from point to point on the r ring. The annular ring inal is located. This ring hanical and electrical -P-55640 as are trace widths, ted specifically in drawing een the artwork master and the process) are also controlled by s from good artwork. Moles which cally interconnect the different port and increased reliability. iminating the possibility of annular ring concentricity, an etching, All copper cladding is easy and reliable soldering at planged storage. S es maximum reliablity. In of solder joints. All leads f large components are staked. It is maximum reliability. It is maximum reliability	
		The Al. AZ. A4, and A6 boards are secured in the ele- beryllium copper card guides. Connections are made i	to the mother board with blind-o

LIMET TYEZHLA FMEA NO. ____5.3.1 SHATTLE CCTV DWG ND. <u>2294819-5**46** 5**0**8/</u> CRITICAL ITEMS LIST 2307088-503 ERITICALITY <u>2/2</u> 3 OF ... 9 FAILURE MODE AND FACLURE EFFECT CAUSE ON ENO ITEN RATIONALE FOR ACCEPTANCE No sutput signal to the YSU. Lass of camera output **DESIGN FEATURES** (Continued) Neither video nor synchronization depicting scane informa-BARE BOARD CONSTRUCTION (A2) information is present. tion within FDV of lens assembly. At Sync Generator The A2 board is of "welded wire" construction. At the bare board level this woes not Clock Divider Chaic. distinguish it from a normal PC board except that holes which will take weld pins Worst Case: 2294880-504 loss of mission critical generally are not connected to PC traces. Only those pins which bring power and A2 Camera Timing Louis pround potentials to the ICs are on PCs. An annular ring surrounds the hole in the video. board where each power and ground pin is located. These pins are then seldered to 2294881-501 the trace like any other component lead. Aside from this feature, all design A4 Sync formatter. Video Output Drive. & construction techniques used in PC board layout apply. 2294884-503 Ab Power On/Off Switching. BOARD ASSEMBLY (AZ) Input Voltage Freregulators. Output Valtage Regulators. The drilled and etched board is populated with several hundred solderable or waldable plus. Power and ground plus, as well as connector plus, are soldered in 2294885-501 A7 DC-8C Converters place. Discreet components (resistors, diodes, capacitors) are attached to Primary Oscillator Driver. bifurcated terminals, where they are soldered. Flatpack ICs are welded, lead-by-lead, to the tops of the weld pins. After welding, extra lead material is Secondary Rectifiers/filters. 2294886-503 trimmed away. Circuit connections are made using #30 AWG nickel weld wire. The AL3 Haster Oscillator wire is welded to the pin surfaces on the board backside. All wire welds are done 2295527-1 using a machine which is tape driven, thus aliminating the possibility of miswiring due to operator error. All wiring & circuit performance is tested prior to box-level installation. After successful testing, components are staked as required by drawing notes and the assembly is coated with prethane. The board is inserted in the box on card-edge guides, in the same manner as the other PC beards. The A7-A low woltage power supply board is bolted to place at 6 points around its perimeter. Four of these mounting screws also pass through and tie down the smaller A7-8 board. These two boards are mounted face-to-face, separated by the standoffs. Electrical interconnections are achieved by jumper wires between the two boards. The A7-A houses a 34-pin connector which brings in power and signals from outside the nodule. The A7 medale includes these two boards as well as power transistor 04. The module housing is bent aluminum sheet, comprised of two halves screwed together. The boards and Q4 are secured to the lower holf, and wired together. Then the upper half is put in place. By counting 04 directly to the aluminum housing, good thermal performance is assured.


67. CM.

FHEA NO. <u>6.3.1</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRETICAL ITEMS LIST	UNIT <u>TVC/VLA</u> DHG ND. <u>2294619-506, 506/</u> <u>2307088-503</u> SHEET <u>4</u> OF <u>9</u>
		RATIONALE FOR ACCEPTA	WCE
		The Al3 assembly is a temperature compensated voltar (TEVERO) that is purchased to a specification control the requirements for performance, design, test, and product assurance provisions of the document contained electronic parts and materials as the Shuttle CCTV approval of RCA and MASA-JSC. Hechanical and electric confirmed by both analysis (design reviews) and the OMALIFICATION TEST. For Qualification Test flow, see Table 2 located at	e controlled crystal oscillator bled drawing that establishes qualification of the unit. The the identical requirements for brogram and must receive the rical integrity of the assembly sest (qualification and acceptance).
		•	

FMEA NO. 5.3.1 CRITICALITY 2/2		SHUTTLE CCTV
FAILURE MODE AND	FAILURE EFFECT	RATIONALE FOR ACCEPTANCE
No output signal to the VSD. Neither video nor synchronization information is present. Al Sync Generator Clock Divider Chain. 2294880-504 A2 Camera Timing Logic 2294881-501 A4 Sync formatter. Video Gutput Drive. 2294884-503 A6 Power Un/Off Switching. Input Voltage Preregulators. Output Voltage Regulators. 2294885-501 A7 DC-DC Converters Primary Oscillator Driver. Secondary Rectifiers/Filters. 2294886-503 A13 Muster Oscillator 2295527-1	ON END TIEM Loss of camera output depicting scene informa- tion within FOV of Tens assembly. Horst Case: Loss of mission critical video.	RAIDMALE FOR ACCEPTANCE ACCEPTANCE IESI The CETV systems' MIA is subjected directly, without vibration isolators which might be used in their normal installation, to the following testing: • Vibration: 20-80Mz: 3 db/Oct-rise from 0.01 G²/Hz 80-350 Hz: 0.04 G²/Hz 350-750 Mz: -3 db/H0 Oct-slope
U2 (GR	5-16D	This proves that the CCIV equipment is operational.

PMEA NO	_	SHUTTLE CCTV CRETICAL ITEMS LIST	UNIT TYC/WLA DHG ND. 2294819-506, 508 2307088-503 SHEET 6 OF 9
FALLURE HODE AND CAUSE No output signal to the VSU. Neither video nor synchromization information is present. Al Sync Generator Clock Divider Chaim. 2294880-504 AZ Camera Timing togic 2294881-501 Ad Sync Formatter. Video Output Orivo. 2294884-503 Ab Power On/Off Switching. Input Voltage Preregulators.	FACILIRE EFFECT ON END ITEM Loss of camera output depicting scene informa- tion within FOV of lens assembly. Horst Case: Loss of mission critical video.	RATIONALE FOR ACCEPTANCE OA/INSPECTION Procurement Control — The TVC/NLA EEE Parts and hardware approved vendors and suppliers, which meet the requirement contract and Quality Plan Work Statement (NS-2593176), review all procurement documents to astablish the need (PAI 517). Incoming Inspection and Storage — Incoming Quality insperceived materials and parts. Results are recorded by drawing and control numbers for future reference and trainer subjected to incoming acceptance tests as called for Inspection Test Instructions. Incoming flight parts are accordance with REA 1846684 — Preconditioning and Acceptance	sheer 6 Of 9 a items are procured from ents set forth in the CCTV Resident DCAS personnel for GS1 on selected parts ections are made on all lot and retained in file by accability. All EEE parts of in PAI 315 - laceming a further processed in tance Requirements for
Output Voltage Regulators. 2294685-501 <u>A7</u> OC-OC Converters Primary Oscillator Driver. Secondary Rectifiers/filters. 2294866-503 <u>A13</u> Master Oscillator 2295527-1	·	Electronic Parts, with the exception that DPA and PIND (Mechanical items are inspected per PAI 316 - Incoming In mechanical items, PAI 305 - Incoming Quality Control last PAI 612 - Procedure for Processing Incoming or Furchased Flight Use. Accepted items are delivered to Material Contested under specified conditions until fabrication is materials are held for Material Review Board (MRB) disport [QC 531]. Board Assembly & lest - Prior to the start of IVC board	nspection Instructions for spection Instruction, and described for ontrolled Stores and street required. Non-conforming osition. [PAI 307,
!		verified to be correct by stock room personnel, as the ifform a kit. The items are verified again by the operator checking against the as-built-parts-list (ABPL). DCAS are designated for all printed circuit, wire wrap and we harness connectors for soldering wiring, crimping, solde workmanship prior to coating of the component side of but harnesses. IVC Beards	or who assembles the kit by. Hoodatory Inspection Points elded wire boards, plus er splices and quality
		Specific TVC board assembly and test instructions are pr	rovided in drawing metes.
		and applicable documents are called out to the fabricati (FPR-2294619) and parts list Pt2294819. These include a 2593660, Process Standard RIV-566 2280881, Process Stand 2280889, Specification Soldering 2280749, Specification 1960167, Specification - Crimping 2280800, Specification 2280878, Specification - Urethane coating 2280877, Speci 2026116, Specification Epoxy Adhesive 2010985, Specification Specification - Workmanship 8030035, Specification Bondi	on Procedure and Record Nouttle TVC assembly notes lard - Bonding Veloro Tape Name Plate Application 1 - Bonding and Staking Ification - locking compound Ition - Marking 2280876,

FAILURE FOR AND CAUSE No output signal to the VSU, No output signal to the VSU, No fine state one year seems. Al Sync Generator Clack Divider Chain. 2394888-504 A Sync Generator Clack Divider Chain. 2994884-513 Fower One/Iff Switching. Input Voltage Preregulators. Output Voltage Preregulators. Output Voltage Preregulators. Output Voltage Preregulators. Output Voltage Preregulators. 2994886-501 A OCCONGWATERS Primary Occillator Driver. 2994886-503 A Natter Occillator Converters Primary Occillator Driver. 2994886-503 A Natter Occillator Converters Primary Occillator Driver. 2994886-503 A Natter Occillator Converters Primary Occillator Driver. 2994886-501 A Natter Occillator Converters Primary Occillator Driver. 2994886-503 A Natter Occillator Driver. 2994886-503 A Natter Occillator Driver. 2994886-501 A Natter Occillator Driver. 2994886-503 A Natter Occillator Driver. 29948	FMEA NO. 5.3.1 CRITICALETY 2/2		SHUTTLE CCTV CRITICAL ITEMS LEST	UNIT TVC/MLA DWG NO. 2294819-586, 508/ 2307088-583 SHEET 7 OF 9
1	CAUSE No output signal to the VSU. Neither video nor synchronization information is present. Al Sync Generator Clock Divider Chain. 2294880-504 Al Camera Timing Logic 2294881-501 Ad Sync formatter. Video Output Drive. 2294884-503 Ab Power On/Off Switching. Input Voltage Preregulators. Output Voltage Regulators. 2294885-501 Al OC-DC Converters Primary Oscillator Driver. Secondary Rectifiers/Filters. 2294886-503 All Haster Oscillator	OH END TIEM Loss of camera eutput depicting scene imforma- tion within FOV of lens assembly. Horst Case: Loss of mission critical	IVC Assembly and lest - An open box test is performed proceed and witnessed, traceability numbers are nare checked prior to use. RCA Quality and DCAS inspect pletion of specified FPR operations in accordance with PAI 217. BCAS personnel witness TVC button-up and crit the Assembly and Jest - An open box test is performed proceeded and calibrated tools are checked prior to use, are performed at the completion of specified FPR operated 205, PAI 217 and PAI 402, BCAS personnel witness they are mated and a final acceptance test is performed witness they are mated and a final acceptance test is performed witness they are mated and a final acceptance test is performed witness and review the acceptance test data/results. They for conformance after all repair, rework and retest. Preparation for Shipment - The TVC and WLA are separated and 2280746, Process standard for Packaging and Handling documentation including assembly drawings, Parts List, Justine 2280746, Process standard for Packaging and Handling documentation including assembly drawings, Parts List, Justine 2280746, Process standard for Packaging and Fackaged in documentation including assembly drawings, Parts List, Justine 2280746, Process standard for Packaging and Fackaged and Ecceptance with the requirements of WS-2593176. RCA QC crating, packaging, packing and marking, and review the	and thermal vacuum. Torques ecorded and calibrated tools ions are performed at the com- PAI 204, PAI 205, PAI 206 and ical torquing. er IP-II-230,0008, Acceptance Test, traceability numbers are PCA Quality and DCAS inspection ions in accordance with PAI 204, it button-up and critical torquin been tested individually, per IP-AI-2294819, including S personnel monitor these se personnel also inspect d prior to shipment after according to CCIV letter 8011 g guidelines. All related ABPL, Test Data, atc., is ecifically to each assembly, ared for each assy in and DCAS personnel witness

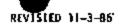

FHEA NO. <u>5.3.1</u> CRETICALITY <u>2/2</u>		SHUTTLE CCTV CRITICAL ITEMS LIST	UNET TYC/YLA DHG NO. 2294819-506, 508/ 2307088-503 SHEET 8 OF 9
FAILURE HODE AND FAILURE EFFECT		RATIONALE FOR ACCEPTANCE	
CAUSE No output signal to the VSU. Neither video nor synchronization information is present. Al Sync Generator Clock Divider Chain. 2294880-504 Al Camera Timing Logic 2294881-501 Ad Sync Formatter. Video Output Orive. 2294884-503 Ab Power On/Off Switching. Input Voltage Preregulators. 2294885-501 Al OC-DC Converters Primary Oscillator Driver. Secondary Rectifiers/filtors. 2294886-503 All Master Oscillator 2295527-1	toss of camera output depicting scene informa- tion within fov of lens assembly. Worst Case: Loss of mission critical video.	10R - H2644 - Log #0462, TVC S/N F003-502 TOR - H2640 - Log #0463, TVC S/N F003-502 Description: Integration Testing Failure	
		Corrective Action: Capacitor CIO removed & rep	laced, (random part failure).

FHEA NO. <u>5.3.1</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRETICAL ETEMS LIST	DWG NO. 2294019-506, 508/ 2302088-503 SHEET <u>QA</u> OF <u>9</u>
FAILURE HOUE AND FAILURE EFFECT		BATTONALE FOR ACCEPTANCE	
CAUSE No output signal to the VSU. Neither video nor synchronization information is present. Al Sync Generator Clock Divider Chaim. 2294880-504 Al Camera Timing Logic 2294881-501 Al Sync Formatter. Video Output Drive. 2294884-503 As Power On/Off Switching. Input Voltage Preregulators. Output Voltage Regulators. 2294865-501 Al DC-DC Converters Primary Oscillator Driver. Secondary Rectifiers/filters. 2294886-503 Al3 Master Oscillator 2295527-1	ON END ITEM Loss of camera output depicting scene informa- tion within FOV of lens assembly. Morst Case: Loss of mission critical videa.	FAILURE MISIORY TOR - W2644 - Log #0462, TVC S/M F003-502 TOR - W2640 - Log #0463, TVC S/M F003-502 Description: Integration Testing Failure Box Level Thermal-Vac Mot Environment No video from TVC. +28 volt current at 1.5 Amp Tivac hot test cycle - 105°f) Cause: Short in A7 low voltage power supply. (Intransformer) Corrective Action: Removed and replaced transformer due to a pin-hole in magnet wire insulation future transformers to be purchased per revised: 649(83028). IDR - M2740 - Log #0486 - TVC S/N 008-502 Rescription: Pre-Launch Test Fallure Box Level Ambient Environment REF: VJCS-2-01-0097 unit returned from KSC. Price (+28V). Cause: Incorrect wiring of shuttle craft harnes RTN to J1-9. Corrective Action: Wiring of shuttle harness to organization. Failure analysis performed and co S/M 000. A6 board-tailure analysis indicated the changed. Q1, Q3, Q12, CR3, CR6, and R51 were reformed box Level Thermal Yac - Hot Environment. TVC drawing excessive current, >1.5A. Fallure Cause: Capacitor C10 on the A6 board was found of solder flowed inside from sleeve thru header.	init. (30 minutes into thermal digh voltage winding of order (sent to vendor for analysis) in the control drawing ECM CCTV discountry and the repaired by responsible or ective action taken on TMC are following parts are to be explaced.
	1	Corrective Action: Capacitor ClO removed & repl	aced, (random part failure).

5-183A

65W-572



FHEA NO. <u>5,3.1</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRETICAL ITEMS LIST	UNIT <u>IVC/NLA</u> BNG NO. <u>2294819-506, 508/</u> <u>2307088-503</u> SHEET <u>6B</u> OF 9
FAELURE HODE AND CAUSE	FAILURE EFFECT ON END ITEM	RATIONALE FOR ACCEP	TANCE
Ho output signal to the VSU. Heither video nor synchronization information is present. Al Sync Senerator Clock Divider Chain. 2294880-504 Al Camera Fiming Logic 2294881-501 Al Sync Formatter. Video Output Drive. 2294884-503 Ab Power On/Off Switching. Input Voltage Praregulators. Bulput Voltage Regulators. 2294885-501 Al DC-DC Converters Primary Oscillator Oriver. Secondary Rectifiers/Filters. 2294886-503 Al3 Haster Oscillator 2295527-1	Loss of camera output depicting scene informa- tion within FOV of lens assembly. Morst Case: Loss of mission critical video.	TOR - M6823 - Log #558 - TVC S/N 012-502 Y1771 - Log #568 - TVC S/N 009-502 Y1771 - Log #568 - TVC S/N 009-502 Y1771 - Log #568 - TVC S/N 009-502 Y1770 - Log #567 - TVC S/N 010-502 Y1770 - Log #567 - TVC S/N 010-502 Y1770 - Log #566 - TVC S/N 010-502 Y1770 - Log #566 - TVC S/N 010-502 Y1770 - Log #566 - TVC S/N 010-502 W1729 - Log #578 - TVC S/N 020-502 Description: flight Failure, Spacecraft Leven RMS TV Camera circuit breaker popped open du Cause: Camera low voltage supply has erratitemperature. Corrective Action: All (light cameras were and retest to ECN C-1881. ECN (C-1881) to the eliminates the erratic syncronization problem changed from 2294819-502 to 504 to denote campower supply modification. IDR - Y1773 - Log #0570 - TVC S/N 008-502 Description: Flight failure Spacecraft Level (S15-3) TVC not synchronized for approximately 38 mlg this problem occured at cold temperature. Synchronization was regained at 2°C. Cause: Loss of phase lock due to thermal assignment and synchronizations (ECN CCI 838) is was modified accordingly. TVC group number in the standard and synchronizations (ECN CCI 838) is was modified accordingly. TVC group number in the standard and synchronization (ECN CCI 838) is was modified accordingly. TVC group number in the standard and synchronization (ECN CCI 838) is was modified accordingly. TVC group number in the standard and synchronization (ECN CCI 838) is was modified accordingly. TVC group number in the standard and synchronization (ECN CCI 838) is spacecraft level. TDR - Y1779 - Log #576 - TVC S/N 614-502 Description: Flight Failure (STS-3) Spacecraft Level TDR was opened to follow relay K1 - contacts 2294885-501 S/N f018.	el ring flight mission STS-3. c syncromization mode at low returned under CCA35 for rework he low voltage power supplies n. TVC group part no. has been neras that contain low voltage wites. Symetry of the 3.58 Mix Phase irecting RCA to incorporate the to all flight camera's. TVC 408 has been updated from group 502 to 506.
0.236R		5.1639	

0236R

5-1638

CCW - 0005

		•	WE114125 11 5 5
FREA NO 5.3.1 CRITICALITY _ 2/2		SHUTTLE CCTV CRITICAL ITEMS LIST	UNIT TYC/H.A. DWG NO. 2294819-506, 508/ 2307068-503 SHEET 8C OF 9
FATEURE HODE AND	FAILURE EFFECT ON END ITEM	RATIONALE FOR ACCEPTANCE	<u> </u>
CAUSE No output signal to the VSU. Neither video nor synchroalization information is present. Al Sync Generator (lock Divider Chain. 2294880-504 A2 Camera Fiming Logic 2294861-501 A4 Sync formatter. Video Dutput Drive. 2294884-503 A6 Fower On/Off Switching. Input Voltage Preregulators. Output Voltage Regulators. 2294885-501 A7 DC-DC Converters Primary Oscillator Driver. Secondary Rectifiers/Filters. 2294886-503 A13 Naster Oscillator 2295527-1	toss of camera output depicting scene informa- tion within FOV of lens assembly. Worst Case: Loss of mission critical viden.	FAILURE HISTORY IDR - 8-3521 - 1ng #1165 - IVC S/N D38-508 Pescription: Acceptance Test Failure	nts and output video information. www.capacitor. Product assurance

REVESED 10-14-4

			KEATZED IN-14-
FREA NO. 5.3.1 CRIFICALITY 2/2 FAILURE MODE AND FAILURE EFFECT ON END ITEM No output signal to the YSU. Loss of camera out depicting scene in		SHUTTLE CCTV CRETICAL ITEMS LIST RATIONAL EFFECTS RATIONAL EFFECTS	UNIT <u>IVC/HLA</u> DWG ND. <u>2294819-506 S08/</u> 2307088-503 SHEET <u>9</u> Of <u>9</u>
information is present. Al Sync Generator	tion within FOV of lens assembly. Horst fase: Loss of mission critical video.	Loss of video. Possible loss of major mission objective or other required cameras. CREM ACTIONS If possible, continue RMS operations using alternative of CREW TRAINING Crew should be trained to use possible alternatives to the MISSION CONSTRAINT Where possible, procedures should be designed so they can convert the continue of th	risual cues. CCTV,
	· · · · · · · · · · · · · · · · · · ·		